ATATEMEN'	of Health Service Re FOR DEFICIENCIES OF CORRECTION	QUISTION (X1) PROVIDER/SUPPLIER/CLIA (DENTIFICATION NUMBER:	(XZ) MULTIPLE A. BUILDING:	CONSTRUCTION	(X3) DATE SURVI	
		HAL092177	B. WING		09/25/20	15
NAME OF P	NOVIDER OR SUPPLIER			TATE, ZIP GODĒ		
WOODLA	ND TERRACE	300 KILDA ÇARY, NG	IRE WOOD: 27511			
(X4) ID PREFIX TAG	ACACH BEERDIEND	TEMENT OF DEFICIENCIES Y MUST BE PRECEDED BY FULL SC IDENTIFYING INFORMATION)	PREFIX TAG	PROVIDER'S PLAN OF CORRECTI (EACH CORRECTIVE ACTION SHOUL CROSS-REPERENCED TO THE APPRO DEPICIENCY)	LD BE CO	(XII) MPLETE DATE
	Initial Comments Report of a Biennic Dennis Harrell con Records indicate to 01/03/2000. The fast seven including Therefore the facilities for Lic Seven or More Be the 1996 (1999 Recordina Building Occupancy and the Adult Care Homes effect at the time of the 1996 (1999 Recordina Building Occupancy and the Adult Care Homes effect at the time of the 1996 (1999 Recording Recorder) for the facilities. This Rule is not 1. There are oxygwithout any restriction occupants of the Eindings on 09/2/2 (1997) (1997)	al Survey by Billy S. Bryant and ducted on 09/23/2015. his facility was first licensed on a 44 Bed Special Care Unit. Ity was surveyed for the applicable portions of the ensing of Adult Care Homes of da and applicable portions of evision) Edition of the North Code(s), Institutional to 1996 Rules for Licensing of a of Seven or More Beds in of initial licensure. Sintained Free of Hazards PHYSICAL PLANT 306 HOUSEKEEPING AND the shall: It is an uncluttered, clean and ree of all obstructions and all apply to new and existing met as evidenced by: It is nearly to new and existing the shall apply to new and existing met as evidenced by: It is nearly to new and existing the shall apply to new and existing the stored in the room alining device or other means to me falling or being knocked over, at are not stored in an oxygen erwise restrained from falling or ver may present a danger to the facility.				
Division of LABORATO	continue the state of the state	n D5 - There are oxygen bottles on oviden/supplier representative's s		2	(X	5) PATE /

STATE FORM

☑ 0002/0010 PRINTED: 10/28/2015 FORM APPROVED

	of Health Service Ke	Signation		ACMICTRUCT: CH	(X2) DATE	ALIBVEY.
	T OF DEFICIENCIES	(X1) PROVIDER/SUPPLIER/GLIA		CONSTRUCTION	(XI) DATE	PLETED
AND PLAN	OF CORRECTION	IDENTIFICATION NUMBER:	A. BUILDING: (01	1	
		l				
		HAL092177	B. WING		09/3	25/2015
	THE OF SUPPLIES	STORET AD	DRESS, CITY, 9	TATE, ZIP CODE		
NAME OF F	'ROVIDER OR SUPPLIER		AIRE WOOD!			
WOODLA	AND TERRAGE	CARY, N		DIM.		
				PROVIDER'S PLAN OF CORE	RECTION	(X5)
(X4) ID PREFIX	/EACH DEFICIENC!	ATÉMENT OF DEFICIENCIES Y MUST BE PRECEDED BY FULL	PREFIX	(EACH CORRECTIVE ACTION 5	HOULD BE	DATE
TAG	REGULATORY OR L	SC IDENTIFYING INFORMATION)	TAĞ	CROSS-REFERENCED TO THE A DEFICIENCY)	PEROPRIATE	IAAI III
				DETIONATION		
C 166	Continued From pa	age 1	C 166			
		*				
	stored upright and	unrestrained.				
C 455	Duttelle e Employee	A Maintained Safe, Committee	C 189			
C 189	Building Equipmen	t Maintained Safe, Operating	0 100			
	SECTION 0300 -	PHYSICAL PLANT				
	10A NCAC 13F .03			,		
	REQUIREMENTS					
	(a) The building at	nd all fire safety, electrical,	1 1			1
	mechanical, and p	lumbing equipment in an adult				
	care home shall be	e maintained in a safe and				
	operating condition),				
	(k) This Rule shall	apply to new and existing				
	facilities with the e	xception of Paragraph (e)				10
	which shall not app	ply to existing facilities.				
	This Rule is not m	net as evidenced by:				
	1. Based on obser	vation the facility is not being				
	maintained in a 88	fe operating condition. In the				
	event of a fire doo	rs are required to completely				'
	close and latch in	order to resist the passage of				
	smoke or the spre	ad of fire. All the occupants in				
	the facility could be	e effected if doors do not latch				
	and to remain shu	t when closed in order to limit				
-	the spread of smo	ke or fire to the area of origin.				
	Findings on 09/25	/2015:				
	a. "A" Hall. Wellne	ess Center - The door did not				
	completely close a					
	b, "A" Hall Cross (Corridor Doors Adjacent to				
		loors did not completely close				
	and latch.					
· '	- WAN MED Texas 5	Japan - The deer did not				
	c, "A" Hall Trash F	Room - The door did not and latch. Note: Corrected while	.			
	the surveyor was	on site.		1		
	nie surveyor was	en ente.				
(2. Bushed on obser	cyation there is a failure to	1			1

8IPK21

図 0003/0010 PRINTED: 10/28/2015 FORM APPROVED

	OF DEFICIENCIES	(X1) PROVIDER/SUPPLIER/GLIA	(X2) MULTIPLE	CONSTRUCTION	(X3) DATE	
	OF CORRECTION	IDENTIFICATION NUMBER:	A, BUILDING: 0	91	GOMP	LETED
		HAL092177	9. WING		09/2	5/2015
NAME OF I	PROVIDER OR SUPPLIER		DRESS, CITY, 8	TATE, ZIP CODE	8111	
1,7			AIRE WOODS			
WOODL	AND TERRACE	GARY, N	C 27511			
(X4) ID PREFIX TAG	(EACH DEFICIENC)	TEMENT OF DEFICIENCIES Y MUST BE PRECEDED BY FULL SC IDENTIFYING INFORMATION)	ID PREFIX TAG	PROVIDER'S PLAN OF (EACH CORRECTIVE ACT CROSS-REFERENCED TO DEFICIENCE	TION SHOULD BE THE APPROPRIATE	COMPLETE DATE
C 189	Continued From pa	ige 2	C 189			
	not limited to the sp findings. Fire resist must be free from a order to resist the a event of a fire. Pen resistant rated celli occupants of the fa	Ifety systems as evidenced but pecific examples cited in the tant rated ceilings and walls openings and penetrations in spread of fire and amoke in the letrations or holes in fire ings or wall could effect the acility by allowing fire and eyond the area of origin.				
,	Findings on 09/23/ a, Legacy Storage wall.	2015 Closet - There is a hole in the				
	b, "C" Hall, Small L holes in the wall wi dismounted,	aundry Room - There are here shelves have been				
	c. "D" Hall, Small L holes in the wall wi dismounted.	aundry Room - There are here shelves have been				
	d, "D" Hall, Large t wall that separates mechanical room.	Laundry - There is a hole in the the laundry from the utility				
	e. "B" Hall Med Sto holes in the ceiling	orage Closet - There are small				
		re is a hole in the fire resistant the fire sprinkler escutcheon				
	maintained in a sa that would prevent rapidly in the even limit the passage of	vation the facility is not being fe manner. Devices are in use doors from being closed t of a fire so as to resist and of smoke and fire. All occupant be effected by allowing fire				,

SIPK21

Division of Health Service Regulation

团 0004/0010 PRINTED: 10/28/2015 FORM APPROVED

	OLLHERITI SCIAICE VI	Menencon				
STATEMEN	IT OF DEFICIENCIES	(X1) PROVIDER/SUPPLIER/CLIA IDENTIFICATION NUMBER:		E CONSTRUCTION	(X3) DATE	
VAD STVN	OF CORRECTION	IDENTIFICATION NOMBER:	A. BUILDING:	01	- COMP	
	,	HAL092177	B. WING		09/2	5/2015
NAME OF	PROVIDER OR SUPPLIER	STREET AD	ORESS, CITY, S	ITATE, ZIP CODE		
		300 KILD	AIRE WOOD	S DRIVE		
WOODL	AND TERRACE	GARY, NO	27511			
(X4) ID PREFIX TAG	(EACH DEFICIENC)	TEMENT OF DEFICIENCIES Y MUST BE PRECEDED BY FULL SCIDENTIFYING INFORMATION)	ID PREFIX TAS	PROVIDER'S PLAN OF CORRECTI (EACH CORRECTIVE ACTION SHOUL CROSS-REFERENCED TO THE APPRO DEFICIENCY)	D BE	(X5) COMPLEYE DATE
C 189	Continued From pa	ge 3	C 189			
	with wedges as evi- following specific e. Both doors in the m required to be self- by door wedges. 4. Based on observ- maintain electrical ocondition. Failure to devices could effec- could be injured if a does not function p Findings on 09/25/3 a "B" Hall Kitchene not trip when tested b "C" Hall Kitchene	n of doors being held open denced but not limited to the xample: hain laundry rooms that are closing room were held open ration there is a failure to aquipment in a safe operating or maintain electrical safety at occupants of the facility who electrical safety equipment roperly. 2015: tte - The electrical GFCI did of with a circuit tester.				
	c. Special Care Are	en tested with a circuit tester. ea, Whirlpool Bath - The not trip when tested with a				
	maintained in safe plumbing safety de by the building cod preventing the pota from being contam	vation the facility is not being operating manner due to vices not installed as required e. Plumbing safety devices able domestic water supply inated that are not installed cupants of the facility by ealth hazards.				
	breakers/back flow	2013: ba - There are no vacuum preventers installed on the heads that can be submerged				

Division of Health Service Regulation

☑ 0005/0010

PRINTED: 10/28/2015 FORM APPROVED

Division of Health Service Regulation STATEMENT OF DEFICIENCIES (X1) PROVIDER/SUPPLIER/CLIA (X2) MULTIPLE CONSTRUCTION (X3) DATÉ SURVEY AND PLAN OF CORRECTION IDENTIFICATION NUMBER: A. BUILDING: 01 HAL092177 09/25/2015 STREET ADDRESS, CITY, STATE, ZIP CODE NAME OF PROVIDER OR SUPPLIER 300 KILDAIRE WOODS DRIVE WOODLAND TERRACE CARY, NC 27511 (XII) COMPLETE SUMMARY STATEMENT OF DEFICIENCIES PROVIDER'S PLAN OF CORRECTION (X4) ID (EACH DEFICIENCY MUST BE PRECEDED BY FULL EACH CORRECTIVE ACTION SHOULD BE PREFIX PREFIX CROSS-REFERENCED TO THE APPROPRIATE DATE REGULATORY OR LISC IDENTIFYING INFORMATION) TAG TAG DEFICIENCY) C 189 C 189 Continued From page 4 in standing or pooled water in the bottom of the shower stall. C 191 Unvented & Portable Elec. Heaters Prohibited SECTION .0300 - PHYSICAL PLANT 10A NCAC 13F ,0311 OTHER REQUIREMENTS (b) There shall be a heating system sufficient to maintain 75 degrees F (24 degrees C) under winter design conditions. In addition, the following shall apply to heaters and cooking appliances. (2) Unvented fuel burning room heaters and portable electric heaters are prohibited. (k) This Rule shall apply to new and existing facilities with the exception of Paragraph (6) which shall not apply to existing facilities. This Rule is not met as evidenced by: 1. Based on observation the facility failed to adhere to the prohibition on the presence of portable unvented electrical heaters. Portable unvented electrical heaters are a potential fire hazard and as such could effect all occupants of the facility. Findings on 09/25/2015: a. Resident Storage Room & Admin Office -There were portable electric heaters stored in the room.. b. Admin Office - A portable electric heater was in the office. Note: The heater was removed while surveyor was on site.

Division of Health Service Regulation

C 193 Ovens, Ranges in Activity or Res. Rooms

SECTION .0300 - PHYSICAL PLANT

C 193

8IPK21

Division	of Health Service Re					
	IT OF DEFICIENCIES OF CORRECTION	(X1) PROVIDER/SUPPLIER/CLIA IDENTIFICATION NUMBER:	(X2) MULTIPLI A. BUILDING:	E CONSTRUCTION	(X3) DATE COMP	SURVEY LETED
			A. HUILLING.	••		
		HAL092177	B. WING		09/2	5/2015
NAME OF I	PROVIDER OR SUPPLIER	STREET AD	DRESS, OITY, S	TATE, ZIF CODE		
WOODL	AND TERRACE	***	AIRE WOOD	S DRIVE		
***************************************		GARY, NO	27511			
(X4) ID PREFIX TAG	(EACH DEFICIENCY	TEMENT OF DEPIGIENCIES MUST SE PRECEDED BY FULL SCIDENTIFYING INFORMATION)	PREFIX TAG	PROVIDER'S PLAN OF CORRECT (EACH CORRECTIVE ACTION SHOU CROSS-REFERENCED TO THE APPRO DEFICIENCY)	LO BE	COMPLETE DATE
C 193	Continued From pa	ge 5	C 193			,
	resident activity or used except under degree of staff superfacility's assessment resident. The open have a locking feat controlled by staff. (5) Ovens, ranges resident rooms shaprovided, controlled equipment by resid by the facility to be equipment in a safe (k) This Rule shall facilities with the exceptions.	and cook tops located in recreational areas shall not be facility staff supervision. The prvision shall be based on the not of the capabilities of each ation of the equipment shall ure provided, that shall be and cook tops located in all have a locking feature if by staff, to limit the use of the ents who have been assessed incapable of operating the				
	the operational req meet the requireme or residents if they with energized (hot Finding on 09/25/2	vation the facility failed to meet uirements for stoves. Failure to int could result in injury to staff accidentally came into contact) stove burners.				
	a. Country kitchen have a safety lock	- The electric stove did not out device.				
C 199	Exhaust Ventilation		C 199			
	SECTION .0300 - F 10A NCAC 13F .03 REQUIREMENTS					
	provided with exha	ust ventilation at the rate of ninute per square foot. This				

8IPK21

	of Health Service Re	equiation		AGNICIONICA	(X3) DATE 5	URVEY
STATEMEN	OF DEFICIENCIES	(X1) PROVIDER/SUFFLIER/CLIA IDENTIFICATION NUMBER:		CONSTRUCTION	COMPLE	TED
WALL STAN	OF CORRECTION	- Series in the	A. BUILDING: 0	"	1	
		HAL092177	s. WING		09/25	/2015
NAME OF P	ROVIDER OR SUPPLIER		DRESS, CITY, 91)
			AIRE WOODS	DRIVE		l
WOODLA	ND TERRACE	CARY, NO	27511			
(X4) ID PREFIX TAG	JEACH DEEKSIENC	TEMENT OF DEFICIENCIES Y MUST BE PRECEDED BY FULL SC IDENTIFYING INFORMATION)	ID PREFIX TAG	PROVIDER'S PLAN OF CORRECT (EACH CORRECTIVE ACTION SHOU CROSS-REFERENCED TO THE APPRO DEFICIENCY)	LD BE	(X5) COMPLETE BATE
	Continued From parequirement does a before April 1, 198 these specified spare (1) soiled linen sto (2) soil utility room (3) bathrooms and (4) housekeeping (5) laundry area. (k) This Rule shall facilities with the ewhich shall not appear the required exhauctive the area exhaust ventilation.	age 6 not apply to facilities licensed 4, with natural ventilation in aces: brage; if tollet rooms; closets; and I apply to new and existing exception of Paragraph (e) bly to existing facilities. net as evidenced by: vation the facility failed provide ast ventilation equipment. This ants of the facility if odors were sea beyond the room requiring it.	C 199	CROSS-REFERENCED TO THE APPRO DEFICIENCY)		

Woodland Terrace, Kisco Senior Living, Cary, NC Plan of Corrective Action

ID Prefix Tag	Statement of Deficiency	Plan of Corrective Action	Completed Date
C166	Section .0800 = Physical Plant 10A NCAC 13F .0306 Housekeeping And Furnishings. • Oxygen Tanks	 Action: All oxygen tanks not in use have been removed from the Woodland Terrace Community. Oxygen Vendors were contacted and advised not to deliver and set in place any tanks that are not properly restrained in a sectional holder. Future Action: Community Management Team, Nursing Staff and Associates will report all non-compliance occurrences immediately to their Supervisor. 	10-01-15
C189	Section :0300 – Physical Plant 10A NCAC 13F :0311 Other Requirements • Fire Doors	 Action: All doors as identified as not being in compliance have been repaired. Future Action: All Fire Doors will be checked on a monthly basis as part of the Communities Preventative Maintenance Program. 	09-29-15
C189	Section .0300 – Physical Plant 10A NCAC 13F .0811 Other Requirements Penetrations or holes in fire resistant rated ceilings or walls.	 Action: All holes and penetrations that were identified in Biennial Survey have been repaired or filled with Fire Block Sealant. Future Action: All contractors performing repairs or service to the Woodland Terrace Building will be reminded not leave holes or penetrations in place when scheduled work has been completed. Community Maintenance Technicians to monitor and report violations to Environmental Services Director 	09-28-15

C189	Section .0300 — Physical Plant 10A NCAC 13F .0311 Other Requirements • Devices	 Action: All Door chocks / wedges have been removed from Woodland Terrace Community. Team Associates have received in Service Training On September 28, 2015 in regard to not using these devices. All Community Management Team Members will monitor and correct on individual occurrences. 	09-28-15
C189	Section .0300 – Physical Plant 10A NCAC 13F .0311 Other Requirements • Electrical Safety – All GFCI Outlets working properly	 Action: All faulty GFCI Outlets as noted in the Survey were removed and replaced with working outlets. Maintenance Technicians to conduct annual inspections of all GFCI outlets. All Associates will be reminded to report malfunction outlets to the Maintenance Department via a Work Order. 	10-02-15
C189	Section .0300 — Physical Plant 10A NCAC 13F .0311 Other Requirements Vacuum Breakers Installed on all detachable Shower Heads.	 Action: All Resident Rooms and Common Bath areas were checked for vacuum breakers. Missing breakers were added on an as needed basis Maintenance Technicians to conduct annual inspections of all vacuum breakers within Assisted Living. 	09-28-15

C193	Section .0300 — Physical Plant 10A NCAC 13F .0311 Other Requirements • Electric Stove Safety Lockout.	 Action: The Environmental Services Director placed a pad lock on the Electrical Shut Off to lock out users. Wellness Director conducted In-Service Training On October 5, 2015 with her Team to ensure compliance and use of padlock. Future Action: Community Management Team, Nursing Staff and Associates will report all non- compliance occurrences immediately to their Supervisor. 	10-05-15
C199	Section .0300 Physical Plant 10A NCAC 13F .0311 Other Requirements • Housekeeping Storage. All Chemicals stored in ventilated rooms.	 Action; On Day of Survey Housekeeping Cleaning Chemicals were moved to a storage room with an exhaust fan. Future Action: Environmental Service Director and Housekeeping Supervisor conducted in Service Training September 28, 2015 on proper storage location. Housekeeping Supervisor to monitor and report any and all occurrences to the Director of Environmental Services. 	09-25-15